


## A UNIVERSAL GASKET

ADTEX is a cord or tape of pure PTFE extruded by a special process that expands and orientates the PTFE, making it soft and flexible. It is for use in flanged joints which are permanently bolted. ADTEX is supplied in flattened cord or thick tape form with a self-adhesive strip to allow easy installation on vertical surfaces.

PTFE is a unique material offering special properties of importance to the process industries. The major properties are:

- Total chemical resistance
- High temperature resistance
- Non-stick
- Low and high temperature flexibility
- Non-ageing
- Completely non-toxic and hygienic
- Suitable for food applications

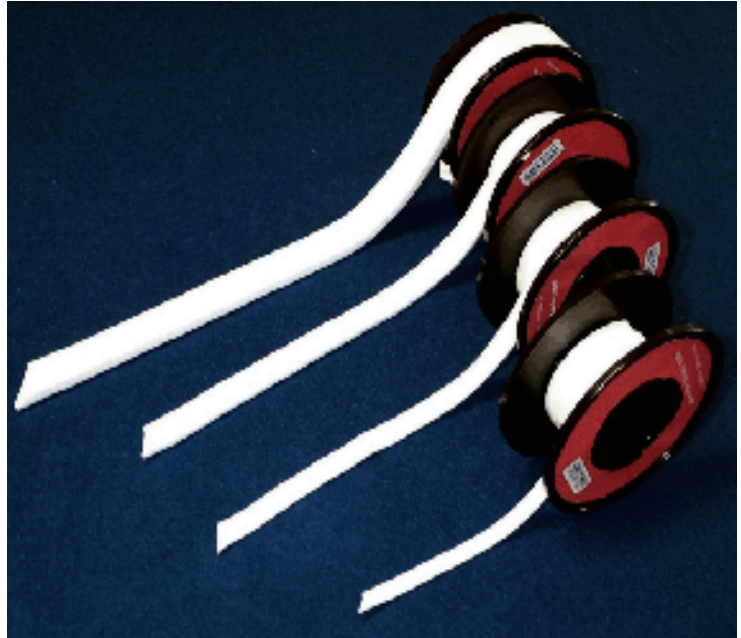

These properties are used to advantage in ADTEX gasket sealing tape, where one product can be used to seal virtually all flange faces in process plants, in process conditions up to 260°C. It can therefore be used as a universal jointing, eliminating the need to stock different grades of gasket for different chemicals and process conditions and as it is supplied in tape form, different gasket sizes no longer have to be stocked.

### Recommended ADTEX sizes for standard flanges

UP TO NOMINAL BORE	TAPE WIDTH
50 mm	3 mm
200 mm	5 mm
600 mm	7 mm
1500 mm	10, 12 mm
+1500 mm	14, 17, 20 mm

### Approvals

1. TUV Test no. MP3/8993
2. BAM Test no. TGB 8609/88 4-2905
3. DVGW Reg. no. G89 e 001

## Advantages of ADTEX PTFE sealing tape:

- \* **Simple trouble free fitting**
- \* **Universal application**
- \* **Minimum wastage**
- \* **Long life**
- \* **High degree of reliability**
- \* **Low and simple stockholding**
- \* **Safe, non-toxic**
- \* **Extremely cost effective**

### Standard Dimensions of ADTEX PTFE Sealing Tape

ADTECH Part No.	Tape Width mm	Tape Thickness mm	Quantity per Reel m
ADX0315	3	1.5	25
ADX0520	5	2.0	25
ADX0725	7	2.5	25
ADX1030	10	3	15
ADX1240	12	4	15
ADX1450	14	5	10
ADX1760	17	6	10
ADX2070	20	7	5

Other reel quantities are available on request.

## Installation Directions

Clean flange surfaces so that self adhesive tape will adhere and fill any large irregularities if necessary. Remove backing strip from adhesive tape and stick the ADTEX tape in a circle inside the circle of bolt holes. Make sure that the ends of the tape overlap just in front of one of the bolts to ensure maximum sealing pressure at that point. Tighten bolts in the normal manner, with further tightening after a few hours of use, particularly if a large degree of temperature cycling occurs. If the joint is found not to have completely sealed it will be because the necessary surface pressures were not achieved. This can be checked by dismantling the joint and observing the flattened tape which should be now transparent and not opaque white. The bolts should be tightened further or a narrower size of tape selected.

### Typical Deformation at Various Clamping Pressures

Size mm	10N/mm <sup>2</sup>	20N/mm <sup>2</sup>	30N/mm <sup>2</sup>	40N/mm <sup>2</sup>
3 x 1.5	3.6 x 0.5	3.8 x 0.4	4.2 x 0.4	4.3 x 0.3
5 x 2	5.8 x 0.7	5.9 x 0.6	5.9 x 0.5	6.0 x 0.3
7 x 2.5	8.7 x 1.0	8.7 x 0.8	8.8 x 0.7	8.8 x 0.6
10 x 3	11.9 x 1.0	11.9 x 1.0	12 x 0.9	12 x 0.7
12 x 4	14.4 x 1.7	14.4 x 1.5	14.6 x 1.2	14.7 x 1.0
14 x 5	16.4 x 1.9	16.6 x 1.4	16.8 x 1.2	16.9 x 1.0
17 x 6	20 x 2.4	20.3 x 1.6	20.3 x 1.3	20.4 x 0.9
20 x 7	23.6 x 2.5	23.9 x 1.9	24 x 1.6	24 x 1.1

**Adtech Polymer Engineering Ltd. Unit 40 Aston Down East, Stroud GL6 8HX, England.  
Phone 01285 762000 Fax 01285 760632**

Specifications and information contained in this leaflet are based on our overall experience. They are correct to the best of our knowledge, but we accept no liability for their accuracy. Specifications and values should be tested by the customer in each application